

September 20, 2007

Chief of Enforcement
Public Utility Commission Transportation & Safety
1203 State Office Building
1400 W. Spring Garden Street
Philadelphia, PA 19130

Subject: Request for Aged Vehicle Inspection: PUC License # A-00122591

Dear Sir/Ma'am,

We specialize in classic, vintage British limousines and serve the surrounding Philadelphia counties. The purpose of this letter is to request permission for a PUC Enforcement-Officer-observed inspection for our 1964 Rolls Royce Silver Cloud III.


1. As this is our only vehicle and classic cars are our specialty, we would not be able to stay in operation (a hardship) if this inspection is not granted. Our company provides customers the unique opportunity to utilize a classic, vintage car that is safe and reliable. In our first year, we have served over 35 customers and were nominated for the Best of Fox Philly competition by our wedding patrons. By granting this inspection, you will enable residents to have continued access to our unique services.
2. Enclosed is a picture of the actual mileage of the vehicle. The Rolls Royce has undergone extensive restoration (\$25,000 in receipts) during the past two years and is in excellent mechanical and cosmetic condition.
3. Enclosed are pictures of the sides, front and rear of the vehicle's exterior.
4. Enclosed are pictures of the vehicles interior seats, dashboard, and floor.
5. Enclosed are maintenance records for 2007.
6. The contact information for the requested certified inspection station is:

Mr. David Cohen
Cloverleaf Auto Service
207 Pennsylvania Avenue
Malvern, PA 19355 (610) 647-5900

7. The vehicle information is as follows:
1964 Rolls Royce, Silver Cloud III, VIN# SEV-427

Thank you for your consideration. Please contact me at (484) 363-1462 if you have any questions or concerns. I look forward to your decision.

Sincerely,

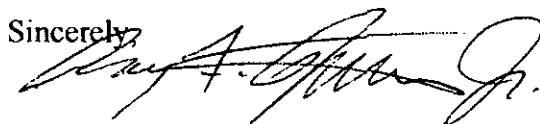

Ray F. Jaklitsch Jr.
CEO
Classic British Limousine Service, Inc.

RECEIVED
DIRECTOR
PUBLIC UTILITY & SAFETY
2007 OCT -5 AM 8:17









PALMA'S AUTOMOTIVE REPAIRS
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
856-547-6522

Repair Order #0008348


Date : 3/29/07

Page : 1

Center :

Customer : JAKLITSCH, RAYMOND Address : 435 WINDING STREAM RD City : SPRING CITY, PA 19475- Phone 1 : (484) 363-1462 Ext : CELL Phone 2 : (610) 669-8810 Ext : FAX		Vehicle : 1964 RR SILVER CLOUD 3 License : GDK6539 Key# : VIN : SEV427 Engine : 298 CID 6/CYL Trans : 4 SPEED HY Mileage : 74474 CODE :	
---	--	---	--

Op	Tech	Description	Part Description	Reason for Replacement	Labor	Parts	Subtotal
	Quan	Part Number				Price	
ES30		TSB ENGINE VALVE SEALS, RENEW.			760.00	86.78	846.78
	2.00	UV 11305PA	GASKET,V/C RUBBER			86.78	
MS 0		TSB MAKE SHORT CHOKE TUBE.			28.50	7.50	36.00
	1.00	CTK320CK	METAL BRAKE LINE			7.50	
EN 0		TSB DRAIN ENGINE OIL & RENEW			47.50	47.41	94.91
	7.00	15W40	AGIP OIL			20.23	
	2.00	JB OTC/6 TREATMENT	ENGINE OIL			21.06	
	1.00	XB1093R	SEALING WASHER /DRAI			1.32	
	1.00	JB HDV/23P ENG/TRANS	LUBRICATION ADDITIVE			4.80	

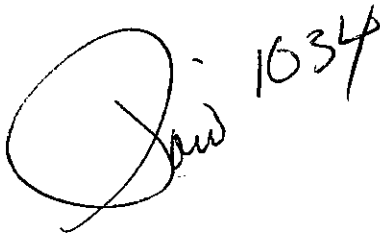OK Bad	Recommendation	OK Bad	Recommendation	OK Bad	Recommendation
					

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

Labor :	\$836.00
Parts :	\$141.69
Sublet :	\$0.00
Other Fees :	\$0.00
	\$4.25
Subtotal :	\$981.94
Sales Tax :	\$68.31
Paid By :	Total : \$1,050.25
Pay Ref :	Paid : \$0.00
	Due : \$1,050.25

x

JTP AUTO SALES & SERVICE, Inc

401 Schulykill Road
 Phoenixville, PA. 19460
 Phone - 610-933-4277

INVOICE

7018

INVOICE

Print Date : 06/16/2006

Classis British Limousine

1964 Rolls Royce - Silver Cloud

435 Winding Stream Rd
 Spring City, PA 19475
 Home 484-363-1462
 Cust ID : 2824

Lic # : Odometer In : 73103
 Unit # : Odometer Out : 73103
 Vin # :
 Hat # : Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
Attempt to charge a/c. Initially held vacuum, at charge system began to leak, found leak at evap (possibly lines), attempt to recover remaining R134a. took 1lb. 8oz, recovered 7 oz.				PA State Inspection	26.00
xx	1.00	50.00	50.00	Finish Installation of A/C Wiring	72.50
Sticker				Hazardous Materials	1.97
AI66359354	1.00	2.00	2.00		
Charge A/C System W/Dye					
xx	1.00	99.95	99.95		
Shop Supplies		2.50	2.50		

[Technicians : C., Tim]

Org. Estimate \$162.72 Revisions \$0.00 Current Estimate \$ 162.72 Additional Cost Revised Estimate

Labor:	\$100.47
Parts:	\$154.45
Sublet:	\$0.00
Sub:	\$254.92

Tax:	\$15.30
Total:	\$270.22
Bal Due:	\$0.00

[Payments - Visa - \$ 270.22]

All Repairs Performed By JTP Auto Sales & Service ,Inc. Are Warrantied for 12 months or 12,000 Miles For Parts, and 90 days or 3000 miles For Labor. All Warranty Repairs Must Be Performed By JTP Auto Sales & Service ,Inc.. JTP Auto Sales & Service, Inc. Will Not Under Any Circumstances Reimburse For Any Repairs Performed Outside Of Our Shop. All deposits for sale vehicles are non refundable.

SIGNATURE..... Date..... Time.....

Hilghman, Michael

PALMA'S AUTOMOTIVE REPAIRS
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
856-547-6522

Repair Order #0006767

Date : 4/10/06

Page : 1

Center :

Customer : JAKLITSCH, RAYMOND
 Address : 435 WINDING STREAM RD
 City : SPRING CITY, PA 19475-

Phone 1 : (484) 363-1462 Ext : CELL
 Phone 2 : (610) 669-8810 Ext : FAX

Vehicle : 1964 RR SILVER CLOUD 3

License : GDK6539

Key# :

VIN : SEV427

Engine : 298 CID 6/CYL

Trans : 4 SPEED HY

Mileage : 72633

CODE :

Op	Tech	Description	Labor	Parts	Subtotal
Quan	Part Number	Part Description	Reason for Replacement	Price	
PM 0		TSB CHECKED OVER CAR, REQUIRES DISASSEMBLING OF SOME COMPONENTS TO WRITE ESTIMATE.	285.00		285.00
BSC0		TSB RENEW FRONT AND REAR BRAKE FLEX HOSES.	237.50	227.45	464.95
	1.00 CD 6249	HOSE, S/C BRAKE REAR		43.37	
	4.00 CD 6241	BRAKE HOSE, FRONT		184.08	
BSC007		TSB RENEW FRONT BRAKE SHOES AND ADJUST SIDE SHOE TO BACKING PLATE ANGLES.	285.00	497.24	782.24
	2.00 RH2755	FRONT SHOES 1/2 SET		497.24	
BSC0		TSB REBUILT REAR WHEEL CYLINDERS AND LUBRICATED EXPANDERS.	285.00	218.08	503.08
	2.00 CD 1607	REAR WHEEL CYL KIT		218.08	
BSC008		TSB RENEW FILL HOSES AND CLAMPS ON UPPER AND LOWER MASTER CYLINDERS.	0.00	56.10	56.10
	2.00 UR14202	HOSE, BRAKE PUMP FEED		51.38	
	4.00 CLAMP	HOSE CLAMP		4.72	
BSC002		TSB ADJUST REAR BRAKE SHOES, MECHANICAL BRAKE LINKAGE, BRAKE SERVO AND HAND BRAKE PULL. NECESSARY TO READJUST STOP LIGHT SWITCH.	285.00		285.00
BSC006		TSB CLEAN BRAKE FLUID RESERVOIR JARS AND BLEED BRAKE SYSTEM.	190.00	87.80	277.80
	4.00 UR2842	GASKT RESERVOIR BOTT		16.84	
	4.00 RR363	BRAKE FLUID, CASTROL		70.96	
PM 008		JDP CHANGE ENGINE OIL, CARTRIDGE OIL FILTER, CHECKED ALL FLUIDS LEVELS AND ADDED AS NEEDED. TOP OFF FRONT AND REAR SHOCKS OIL LEVELS.	142.50	46.49	188.99
	7.00 AGIP	20W50, ENGINE OIL		16.59	
	2.00 LUCAS	OIL STABILIZER		29.90	
ES30		TSB RENEW ENGINE VALVE COVER GASKETS.	190.00	288.79	478.79

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

Raymond Jaklitsch 10/2

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor : \$14,924.24
 Parts : \$7,953.20
 Sublet : \$321.66
 Other Fees : \$0.00
 \$10.00
 Subtotal : \$23,209.10
 Sales Tax : \$1,329.01

Paid By : Total : \$24,538.11
 Pay Ref : Paid : \$18,000.00
 Due : \$6,538.11

PALMA'S AUTO MOTIVE REPAIRS
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
856-547-6522

Repair Order #0006767
 Date : 4/10/06
 Page : 2
 Center :

Customer : JAKLITSCH, RAYMOND Address : 435 WINDING STREAM RD City : SPRING CITY, PA 19475- Phone 1 : (484) 363-1462 Ext : CELL Phone 2 : (610) 669-8810 Ext : FAX	Vehicle : 1964 RR SILVER CLOUD 3 License : GDK6539 Key# : VIN : SEV427 Engine : 298 CID 6/CYL Trans : 4 SPEED HY Mileage : 72633 CODE :
---	---

Op	Tech	Description	Part Description	Reason for Replacement	Labor	Parts	Subtotal
	Quan	Part Number				Price	
	2.00	UV 11305PA	RUBBER GASKET			98.96	
	6.00	UV 11306PA	ISOLATOR BUSHING			92.40	
	6.00	UV 11307PA	SPACER, VALVE COVER			92.34	
	1.00	UE35022D	O-RING, FLAME TRAP BR			3.59	
	1.00	CK612	O-RING, BREATHER & TH			1.50	
EN 0		TSB RENEW FRONT ENGINE MOUNT.			95.00	131.51	226.51
	1.00	UR4639	FRNT ENG MNT S/C V8			131.51	
CFT0		TSB RENEW FRONT OUTER SWAY BAR LINK BUSHINGS.			66.50	97.36	163.86
	8.00	W1503	BUSHING SWAY BAR LIN			97.36	
PA30		TSB RESEAL STEERING RAM, REMOVE AND REINSTALLED			475.00		475.00
PA30		TSB RENEW STEERING BOX BUSHINGS.			161.50	131.63	293.13
	1.00	UR8175	BUSH, P/S FRONT TORQ			39.49	
	1.00	UR8149	P/S BOX BUSHING SHOR			33.84	
	1.00	UR8148	BUSHING, LONG P/S BOX			58.30	
SU 009		TSB REPLACED REAR LEAF SPRING BUSHINGS.			760.00	561.12	1321.12
	8.00	UR1301	BUSHING, REAR LEAF S			561.12	
CRS0		TSB RENEWED BUSHINGS ON REAR SHOCK ARMS.			427.50	268.72	696.22
	4.00	UR6373	SHOCK, BUSHING S/C			268.72	
CS30		TSB RENEW LOWER AND UPPER RADIATOR HOSES. DRAIN AND FLUSH RADIATOR AND ENGINE BLOCK. NECESSARY TO RENEW DRAIN PLUG SEALING WASHER ON DRAIN PLUGS. RE FILL WITH NEW ANTIFREEZE, DISTILLED WATER MIXTURE.			256.50	199.56	456.06

OK Bad	Recommendation	OK Bad	Recommendation	OK Bad	Recommendation

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.
 WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor :	\$14,924.24
Parts :	\$7,953.20
Sublet :	\$321.66
Other Fees :	\$0.00
	\$10.00
Subtotal :	\$23,209.10
Sales Tax :	\$1,329.01
Paid By :	Total : \$24,538.11
Pay Ref :	Paid : \$18,000.00
	Due : \$6,538.11

PALMA'S AUTOMOTIVE REPAIRS
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
856-547-6522

Repair Order #0006767

Date : 4/10/06

Page : 3

Center :

Customer : JAKLITSCH, RAYMOND
 Address : 435 WINDING STREAM RD
 City : SPRING CITY, PA 19475-
 Phone 1 : (484) 363-1462 Ext: CELL
 Phone 2 : (610) 669-8810 Ext: FAX

Vehicle : 1964 RR SILVER CLOUD 3
 License : GDK6539 Key# :
 VIN : SEV427
 Engine : 298 CID 6/CYL Trans : 4 SPEED HY
 Mileage : 72633 CODE :

Op	Tech	Description	Labor	Parts	Subtotal
Quan	Part Number	Part Description	Reason for Replacement	Price	
6.00		ANTIFREEZE PII			38.28
1.50		DISTILLED			4.47
1.00	UR8124	HOSE, LOWER RAD S/C 3			61.56
1.00	UR8127	HOSE, UPPER RAD S/C-3			81.24
1.00	UA10407R	BY PASS HOSE S/C			14.01
TC30	TSB	TRANSMISSION SERVICE, DROP PAN, CLEAN FILTER & FILL WITH NEW FLUID.	95.00	13.24	108.24
1.00	UG 809	GASKET, TRANS ALUMINU			4.24
4.00	ATF	TRANS FLUID 111			9.00
MS 0	TSB	ADJUST PARK SWITCH	95.00		95.00
EBT0	TSB	HORN COVER	0.00		
PA30	TSB	R&R POWER STEERING PUMP, RESEAL.	665.00	300.61	965.61
1.00		SEAL KIT S/C 2 LHD			294.61
4.00		POWER STEERING FLUID			6.00
FU 001	TSB	CHECKED SU CARBURETOR SETTINGS, NECESSARY TO DISASSEMBLE UPPER SUCTION CHAMBERS AND PISTONS, CLEAN AND INSPECT ALL PARTS. CHECKED SETTING ON THROTTLE PLATES, CHOKE, MAIN JETS & NEEDLES, FLOAT HEIGHTS AND FUEL FILTER IN FLOAT LID HOUSINGS. ADJUST ALL SETTING IF NECESSARY AND RENEWED OR RE SEALED ANY PARTS AS NEEDED.	380.00		380.00
TU 0	TSB	INSTALLED IGNITION WIRE SET AND RENEW SPARK PLUGS. REPLACED AIR FILTER, CLEAN AND RE SEAL REAR MAIN FUEL FILTER.	380.00	490.21	870.21
1.00	UE5801	AIR FITLER, S/C PAPE			38.01

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor : \$14,924.24
 Parts : \$7,953.20
 Sublet : \$321.66
 Other Fees : \$0.00
 \$10.00
 Subtotal : \$23,209.10
 Sales Tax : \$1,329.01

Paid By : Total : \$24,538.11
 Pay Ref : Paid : \$18,000.00
 Due : \$6,538.11

PALMA'S AUTOMOTIVE REPAIRS
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
856-547-6522

Repair Order #0006767
 Date : 4/10/06
 Page : 4
 Center :

Customer : JAKLITSCH, RAYMOND Address : 435 WINDING STREAM RD City : SPRING CITY, PA 19475- Phone 1 : (484) 363-1462 Ext : CELL Phone 2 : (610) 669-8810 Ext : FAX	Vehicle : 1964 RR SILVER CLOUD 3 License : GDK6539 Key# : VIN : SEV427 Engine : 298 CID 6/CYL Trans : 4 SPEED HY Mileage : 72633 CODE :
---	---

Op	Tech	Description	Labor	Parts	Subtotal
Quan	Part Number	Part Description	Reason for Replacement	Price	
		AND RE SEAL REAR MAIN FUEL FILTER.			
8.00	3013	PLUG		25.92	
1.00	87233	IGNITION PLUG WIRES		400.00	
1.00	ZB-ZB711	IGNITION COIL WIRE		26.28	
ISC0	TSB	INSTALLED CUSTOMERS SUPPLIED AFTER MARKET IGNITION SYSTEM.	380.00		380.00
BOD0	TSB	FRONT FLYING LADY BASE PEDESTAL CAP IS MISSING AND LADY IS NOT RIGHT.	161.50	98.94	260.44
1.00	UE 1439	PEDESTAL CAP, LADY		98.94	
PM 002	TSB	LUBRICATE CHASSIS	66.50		66.50
PM 005	JDP	DIFFERENTIAL SERVICE, DRAIN DIFFERENTIAL AND CHANGE OIL.	66.50	36.00	102.50
3.00	MOLY GEAR OIL	MOLY GEAR OIL		36.00	
BOD005	TSB	REMOVE BODY GROUNDS TO CLEAN OTHERS. ADDED ONE NEW GROUND ON PASSENGERS SIDE	237.50	15.03	252.53
1.00	GROUND STRAP	GROUND STRAP		15.03	
EX 002	TSB	RENEWED LEFT AND RIGHT EXHAUST DOWN PIPE MOUNTING FLANGE AND SEALING GASKETS.	380.00	118.00	498.00
2.00	UE73544R	GASKET, EXH/MANIFOLD		10.00	
2.00	S/C EXH DOWN PIPE	FLANGE ADAPTER		108.00	
BSC001	TSB	BRAKE SERVO ASSEMBLY. REMOVE AND REINSTALL INSPECT, CLEAN SERVO ASSEMBLY	285.00		285.00
		AND REPLACED LINING, SPRING COVER, OUTER BAND RUBBER, OUTER BAND CLAMP AND MAI			
		DRIVE GEAR IF NEEDED, RE SEAL SERVO SHAFT.			
SU 007	JDP	FREIGHT, UPS PARTS DELIVERY.\$56.00 1/11/06 DOOR PANELS \$64.64 HIL BORN INV	189.70		189.70
		17489 \$30.00 SEAT BELTS INV 1/11/2006PJNH \$30.00			

OK	Bad	Recommendation	OK	Bad	Recommendation	OK	Bad	Recommendation

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.

WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor :	\$14,924.24
Parts :	\$7,953.20
Sublet :	\$321.66
Other Fees :	\$0.00
	\$10.00
Subtotal :	\$23,209.10
Sales Tax :	\$1,329.01
Paid By :	Total : \$24,538.11
Pay Ref :	Paid : \$18,000.00
	Due : \$6,538.11

PALMA'S AUTOMOTIVE REPAIRS
529 WEST KINGS HIGHWAY
AUDUBON, NJ 08106
856-547-6522

Repair Order #0006767
 Date : 4/10/06
 Page : 6
 Center :

Customer : JAKLITSCH, RAYMOND
 Address : 435 WINDING STREAM RD
 City : SPRING CITY, PA 19475-
 Phone 1 : (484) 363-1462 Ext : CELL
 Phone 2 : (610) 669-8810 Ext : FAX

Vehicle : 1964 RR SILVER CLOUD 3
 License : GDK6539 Key# :
 VIN : SEV427
 Engine : 298 CID 6/CYL Trans : 4 SPEED HY
 Mileage : 72633 CODE :

Op	Tech	Description	Labor	Parts	Subtotal
Quan	Part Number	Part Description	Reason for Replacement	Price	
BTI012	TSB	REMOVED AND RE INSTALLED ALL DOOR PANELS, INSTALLED PROTECTIVE PLASTIC BEHIND DOOR PANELS. CHECKED OPERATION OF ALL ELECTRIC WINDOWS. NECESSARY TO LUB ALL WINDOW LIFT CHAINS AND REPLACE DRIVERS DOOR PULL RELEASE ASSEMBLY. ADJUSTED ALL DOOR LATCHES.	760.00	167.00	927.00
1.00	USED DOOR	LATCH ASSEMBLY		167.00	
FU 025	TSB	REPLACED LEAKING MAIN FLEX FUEL LINE.	95.00	117.60	212.60
1.00	UE6123R	FUEL LINE, FLEX STAI		117.60	
SU 007	TSB	FREIGHT, UPS PARTS DELIVERY. USED DOOR LATCH R/F.	56.96		56.96
BOD0	TSB	CHECK FOR RATTLE NOISE COMING FROM LEFT REAR UNDERSIDE. FOUND BUMPER MOUNTING LOOSE AND FULLER PANEL HITTING BRACKETS.	95.00		95.00
FU 0	JDP	WELD EXHAUST TAIL PIPE CHROME TIP TO TAIL PIPE.	28.50		28.50
SU 012	JDP	WASH AND WAX EXTERIOR AND VACUUM INTERIOR.	0.00		
MS 0	JDP	CUT TWO MASTER KEY BLANKS.	0.00		

OK Bad Recommendation OK Bad Recommendation OK Bad Recommendation

I hereby authorize the repair work to be done along with the necessary parts and materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control.
 WARRANTY IS 90 DAYS OR 4000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

X

Labor : \$14,924.24
 Parts : \$7,953.20
 Sublet : \$321.66
 Other Fees : \$0.00
 \$10.00
 Subtotal : \$23,209.10
 Sales Tax : \$1,329.01
 Paid By : Total : \$24,538.11
 Pay Ref : Paid : \$18,000.00
 Due : \$6,538.11

October 6, 2007

Mr. David Thompson
Public Utility Commission
Bureau of Transportation & Safety
P.O. Box 3265
Harrisburg, PA 17105-3265

Subject: Request for Aged Vehicle Inspection: PUC License # A-00122591

Dear David,

Per our conversation, enclosed are additional pictures (odometer reading, dashboard, and front seats) of our 1964 Rolls Royce Silver Cloud III (VIN: SEV 427). I have included copies of our banking statements and a financial summary to substantiate the financial hardship.

The cost of a 2007 Rolls Royce Phantom is \$345,000. Given that we specialize in British limousines and our business' finances, we would not be able to purchase a new vehicle. Therefore, not approving the waiver for this vehicle would cause financial hardship for the business.

Thank you for your assistance. Please contact me at (484) 363-1462 if you have any questions or concerns. I look forward to your decision.

Sincerely,



Ray F. Jaklitsch Jr.
CEO
Classic British Limousine Service, Inc.

RECEIVED
BUREAU OF
TRANSPORTATION & SAFETY
2007 OCT -9 11:30



DOCKETED
NOV 21 2007

**Classic British Limousine Service (A-00122591)
2007 Financial Summary**

	Opening Balance	January	February	March	April	May	June	July	August	September	TOTAL
Revenue	\$ 2,973.86	\$ 470.00	\$ 1,259.00	\$ 1,863.00	\$ 1,393.40	\$ 3,360.00	\$ 690.00	\$ 2,855.14	\$ 9,551.70	\$ 925.00	\$ 25,341.10
Expenses		\$ 2,604.61	\$ 847.77	\$ 727.50	\$ 1,949.41	\$ 3,522.98	\$ 1,636.49	\$ 756.15	\$ 9,193.36	\$ 1,674.84	\$ 22,913.11
Income		\$ (2,134.61)	\$ 411.23	\$ 1,135.50	\$ (556.01)	\$ (162.98)	\$ (946.49)	\$ 2,098.99	\$ 358.34	\$ (749.84)	\$ 2,427.99

Cost of a 2007 Rolls Royce
Phantom
\$ 345,000.00 *

Given that we specialize in British limousines and based upon the finances of the business, we are unable to purchase a new Rolls Royce or Bentley. Not approving the waiver for this vehicle would therefore cause hardship for the business.

* Based upon Kelly Blue Book new car values.



COMMONWEALTH OF PENNSYLVANIA
PENNSYLVANIA PUBLIC UTILITY COMMISSION
P.O. BOX 3265, HARRISBURG, PA 17105-3265

IN REPLY PLEASE
REFER TO OUR FILE

November 20, 2007

CLASSIC BRITISH LIMOUSINE SERVICE INC
435 WINDING STREAM ROAD
SPRING CITY PA 19475

RE: A-00122591

Dear Ray F. Jaklitsch Jr.:

The vehicle shown on the enclosed Official Approval Form has been approved for use during the calendar year 2008. Please ensure that the Approval Form is carried in the specified vehicle at all times.

It should be noted that the effective date of the 8-year requirement for taxicab and limousine vehicles has been extended from August 6, 2007 to January 1, 2008. Therefore, an approval form for the remainder of 2007 will not be necessary.


If you are contemplating submitting the aforementioned vehicles for the calendar year 2009, the suggested period for doing so will be July 1, 2008 to September 30, 2008. It is highly recommended to start the process in early July to allow adequate time for the initial review and scheduling of inspections.

Please feel free to contact Compliance Specialist David Thompson with any questions. You may reach him at (717) 214-7155 or you may write to his attention at the above address.

Very truly yours,

Wendy J. Keezel, Chief of Enforcement
Motor Carrier Services and Enforcement Division
Bureau of Transportation and Safety

DOCKETED
NOV 21 2007

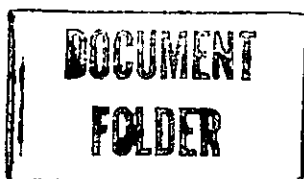



OFFICIAL APPROVAL FORM

CLASSIC BRITISH LIMOUSINE SERVICE INC. A-00122591

This vehicle has been inspected and approved for use during the calendar year 2008.

Year 1964
Make ROLLS ROYCE
Model SILVER CLOUD III
Vin SEV427




Wendy J. Keezel

**Wendy J. Keezel, Chief of Enforcement
Motor Carrier Services and Enforcement
Bureau of Transportation and Safety**

Expires December 31, 2008

This form must be carried on board the vehicle at all times to be temporarily exempt from the eight-year vehicle age requirement.

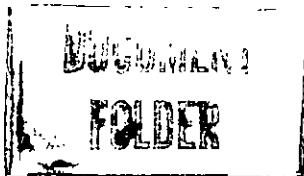

DOCKETED
NOV 21 2007